

MONUMENT RECORD


Corner I.D. #

P-11

STATE OF INDIANA - COUNTY OF MONROE

Section Fifteen (15), Township 10 North, Range 1 West

Monument Description & Remarks: SW Corner of E 1/2 of NE 1/4 calculated &
located . . . posted with plastic signs. Witnessed 10/18/85.

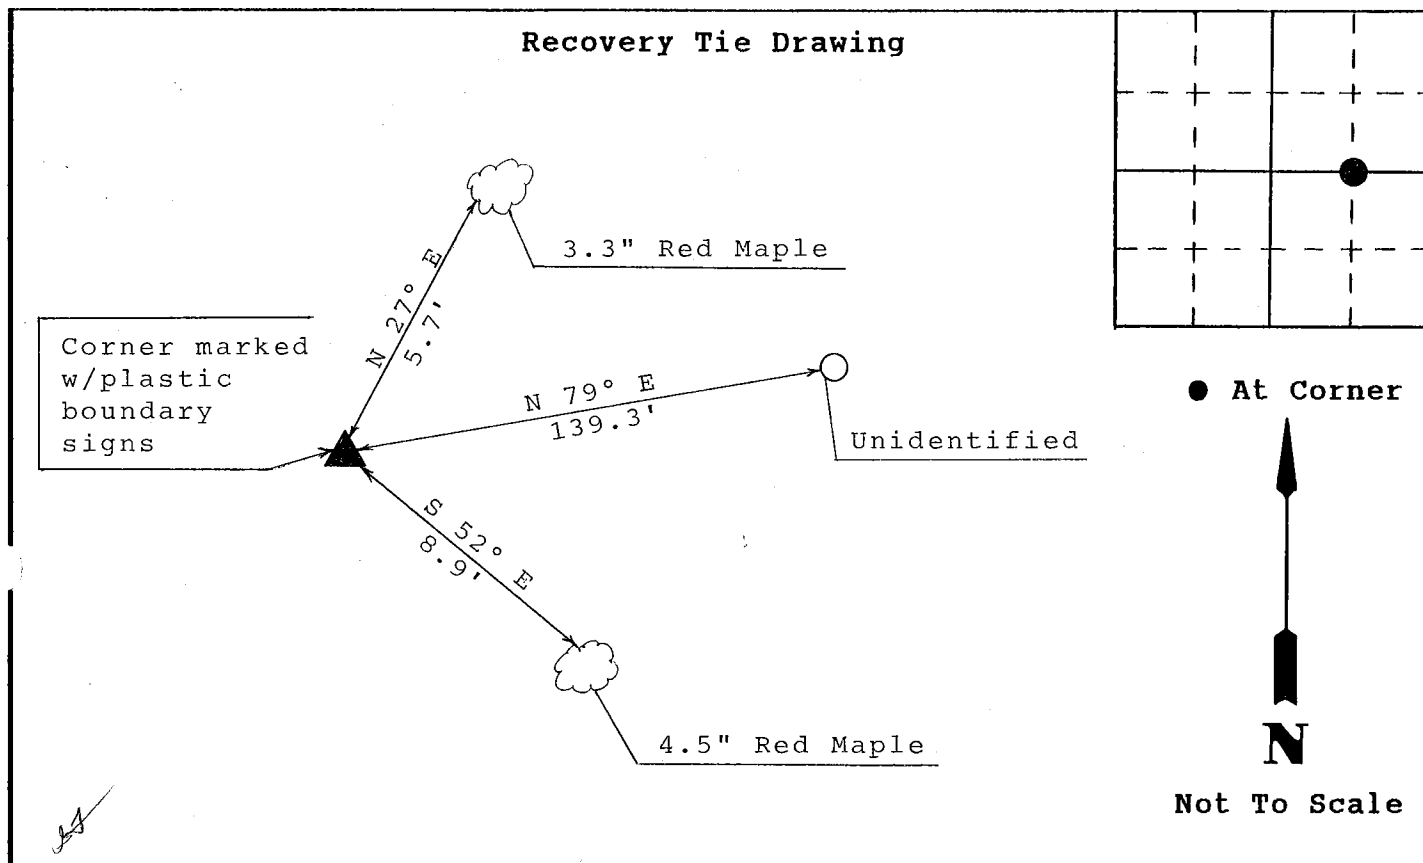

State of Indiana
County of Monroe

Space
Reserved For
Recording
Officer

I, Michael W. Friley, County Surveyor, hereby certify
that this document was prepared under my direction in
accordance with the provisions of Section 17-3-64-4
through 17-3-64-8 of the Indiana Code, being Acts of 1965,
Chapter 319; and the above data is given under my hand and
seal this 9th day of November, 19 93 A.D.

Indiana Registered Land Surveyor No. _____ or

Morgan-Monroe State Forest

United States Government Agency

Darrell Breedlove, Timber Specialist

Title

Field Book:

n/a

Page:

n/a

E. =a compass line was run east from NW corner, NE $\frac{1}{4}$, SW $\frac{1}{4}$ to a 29.3" beech with wire that appeared to be on the section line in June, 1984. Wire closing on this tree from the east and west suggests that it is the $\frac{1}{4}$ - $\frac{1}{4}$ corner.

Y. =SW corner E $\frac{1}{2}$, NE $\frac{1}{4}$ was calculated and located from the intersection at above mentioned compass lines. It is due east of NW corner, NE $\frac{1}{4}$, SW $\frac{1}{4}$ (1° W declination) and Az 360° 10' from SE corner W $\frac{1}{2}$, SE $\frac{1}{4}$. This corner was posted with plastic signs and can be relocated by the following witnesses:

Azimuth	079	027	128 ^{52°E}
Species		REM*	REM*
Reference	Old metal boundary Signs @ errant fence corner		
DBH _{ob} (in)	On Fishel's Property		
		3.3	4.5
Distance (ft)	139.3	5.7	8.9

*posted with plastic boundary signs

=contradictory evidence was observed at the middle of NE $\frac{1}{4}$. A white oak with wire was observed 40.5 ft west of the calculated boundary line near the $\frac{1}{4}$ - $\frac{1}{4}$ corner. However, it was rejected as being too far out of agreement with other evidence. It sits on the state side of the fence about 45 ft.

=the south and west sides of SE $\frac{1}{4}$, NE $\frac{1}{4}$ were painted and posted. the west side of NE $\frac{1}{4}$, NE $\frac{1}{4}$ was not painted, but there is a well-maintained and obvious fence-line.

Darrell Breedlove

Darrell Breedlove, Timber Specialist

4. On July 29, 1988, a steel fence post was driven next to the stone at the southwest corner, SE $\frac{1}{4}$, SE $\frac{1}{4}$, Sec.15. This stone, also, has a pipe next to it that was driven as part of an adjoining survey (surveyor: Guy Moore). It was set by witnesses (see entry#3*) following disturbance by loggers in 1986. The stone was recovered by Breedlove and positioned next to the pipe.

Also on this date, a steel fence post was driven at the SE corner, of Sec.15. According to Hugh Gorman(see entry#1), Farkas, Monroe County Surveyor, substantiated that the stone had been destroyed and that the depression was the correct location of the section corner. The post was driven next to another thin, steel, channel marker found in the depression.

Darrell Breedlove

Darrell Breedlove, Timber Specialist